

1 OPEN THE SAFETY DOOR, UNLOCK AND REMOVE THE CYLINDER CUP




2 TIGHTEN THE CYLINDER CUP ON THE SPRAY CAN



3^A SOLVENT-BASED PAINT
ADD 100 ml PAINT IN THE CYLINDER CUP



3^B 2K ACRYLIC PAINT
ADD 20 ml SPRAY FILL CONVERTER + 80 ml PAINT

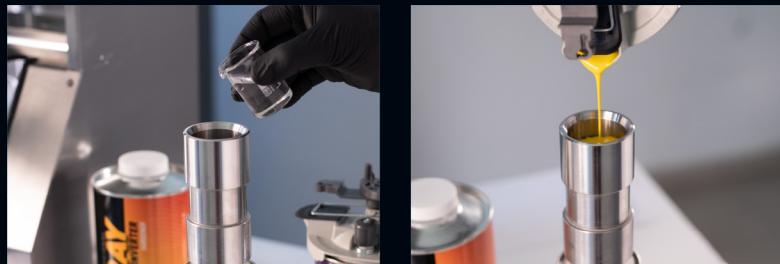


4 PLACE THE CAN WITH THE CYLINDER CUP



5 LOCK + CLOSE THE SAFETY DOOR



6^A PNEUMATIC MACHINE
LIFT THE LEVER AND HOLD IT UNTIL THE PROCESS IS COMPLETE

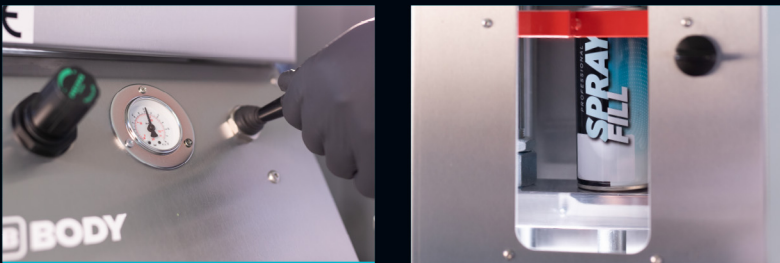

6^B MANUAL MACHINE
TURN THE SWITCH TO THE "CLOSE" POSITION



MOVE THE LEVER UP AND DOWN UNTIL THE CONTAINER STOPS MOVING



TURN THE SWITCH TO "OPEN" POSITION TO COMPLETE THE PROCESS



7 OPEN THE SAFETY DOOR + UNLOCK



8 DETACH THE CYLINDER CUP + PLACE THE NOZZLE



9 SHAKE WELL FOR 3-4 MINUTES.



10 SPRAY AT DISTANCE OF 20-30 CM APPLYING THIN COATS



PRODUCT TYPE	AMOUNT OF PRODUCT	AMOUNT OF CONVERTER	THINNER
1K Primer	100 ml	0 ml	0 ml
1K Paint	100 ml	0 ml	0 ml
1K Clear Coat	100 ml	0 ml	0 ml
2K Primer	80 ml	20 ml	0 ml
2K Paint	80 ml	20 ml	0 ml
2K Clear Coat	80 ml	20 ml	0 ml
2K High Build Primer	70 ml	20 ml	10 ml
2K UHS Clear Coat	70 ml	20 ml	10 ml
Solvent Base Coat	100 ml	0 ml	0 ml